



**WISDOM INDUSTRIES, INC**



## **SIZZLER BULLETIN**

**DATE:** MAY 1997  
**RIDE:** SIZZLER/DELUXE SIZZLER FOOT TUB  
**SUBJECT:** Inspect the pivot hole on each side of each foot tub on the SIZZLER/DELUXE SIZZLER for corrosion and excessive wear.  
**COMPLIANCE:** Inspection daily before operating ride.

### **Inspection**

1. Inspect the pivot hole on the foot tub for excessive wear. Approximately 1/8th maximum play on foot tub next to hinge.
2. Inspect the fiberglass in the hinge area for cracks or fracturing which would indicate the internal steel is broken or worn to the point of relying on the fiberglass for strength. (Hole should be centered on boss on side of fiberglass foot tub.)
3. Check clearance of the foot tub to the gooseneck. Minimum 2" clearance with a person standing on the step of the foot tub. Measure to the corner of the gooseneck.
4. If foot tub noticeably slopes down, perform inspection before allowing passengers in the seat. Close any seat that does not meet this inspection criteria.

Replacement of the foot tub or foot tub internal steel is required for repair.

### **\*\*WARNING\*\***

**Failure of the foot tub hinge point will result in injury to your passengers.**

Contact Wisdom Industries with any discrepancies on the foot tubs that you find which will require replacement or reinforcement of the foot tub hinge.

If you no longer own this ride, please contact us so we can update our records. Thank you for your cooperation in this matter. If you have any questions about this bulletin, please feel free to contact us at 1-800-634-6097 or 1-970-522-7515.