SAFETY AND SERVICEABILITY

Leisure Technical Consultants Limited

TYPE 'A' REGISTERED INSPECTION BODY

Providing a "UNIQUE & TOTAL" service to the Leisure Industry and the World

www.ltci.co.uk

Leisure Technical Consultants Limited

Urgent Defect Notice

Date: 08.02.2011.

Device: Huss - Enterprise.

Defect: Cracking near the upper ram attachment area.

Device ages: 10 & 28 years old.

Leisure Technical Consultants Limited. © 2007-2011 - All rights reserved - Registered in England 2075836
VAT Registration No. 453204577

Leisure Technical Consultants Limited

SAFETY AND SERVICEABILITY

TYPE 'A' REGISTERED INSPECTION BODY

Providing a "UNIQUE & TOTAL" service to the Leisure Industry and the World

www.ltci.co.uk

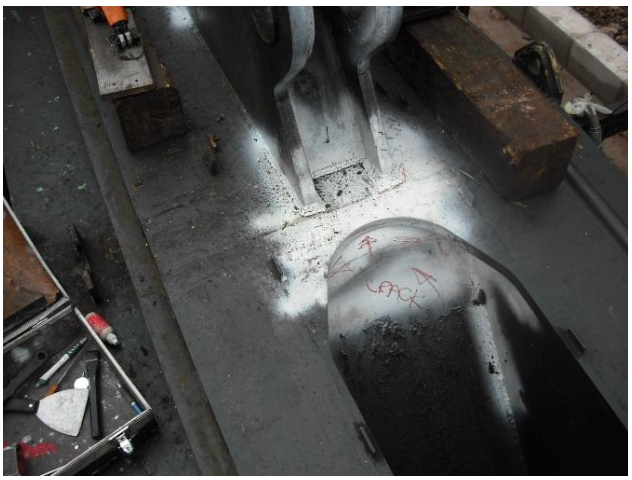

The defect has now been found on two enterprise devices. The cracking is located below the upper ram attachment area and under the main boom plate. Both areas of cracking that have been found are between 370mm - 390mm long and were both found visually and then subjected to MPI to establish the full length of the crack.

One of the devices was inspected with the ram removed and the other with the ram in place; on both devices the cracking was easily found.

The Manufacturer's Huss has been informed and we are awaiting their response.

Leisure Technical Consultants Limited. © 2007-2011 - All rights reserved - Registered in England 2075836
VAT Registration No. 453204577

Leisure Technical Consultants Limited

SAFETY AND SERVICEABILITY

TYPE 'A' REGISTERED INSPECTION BODY

Providing a "UNIQUE & TOTAL" service to the Leisure Industry and the World

www.ltci.co.uk

Leisure Technical Consultants Limited. © 2007-2011 - All rights reserved - Registered in England 2075836
VAT Registration No. 453204577